

Turn Off Element Display

To run this script


Select **Scripts > Schematic > TurnOFF_Element_Display** from the Menu.

Or, in versions that support the script, you can run the utility directly from this page using this button.

Description

This is a simple script to turn off schematic element display for model names and IDs. Many times you know what the model is from the symbol and you don't want this extra information cluttering your schematic.

Below is an example with the full schematic display:

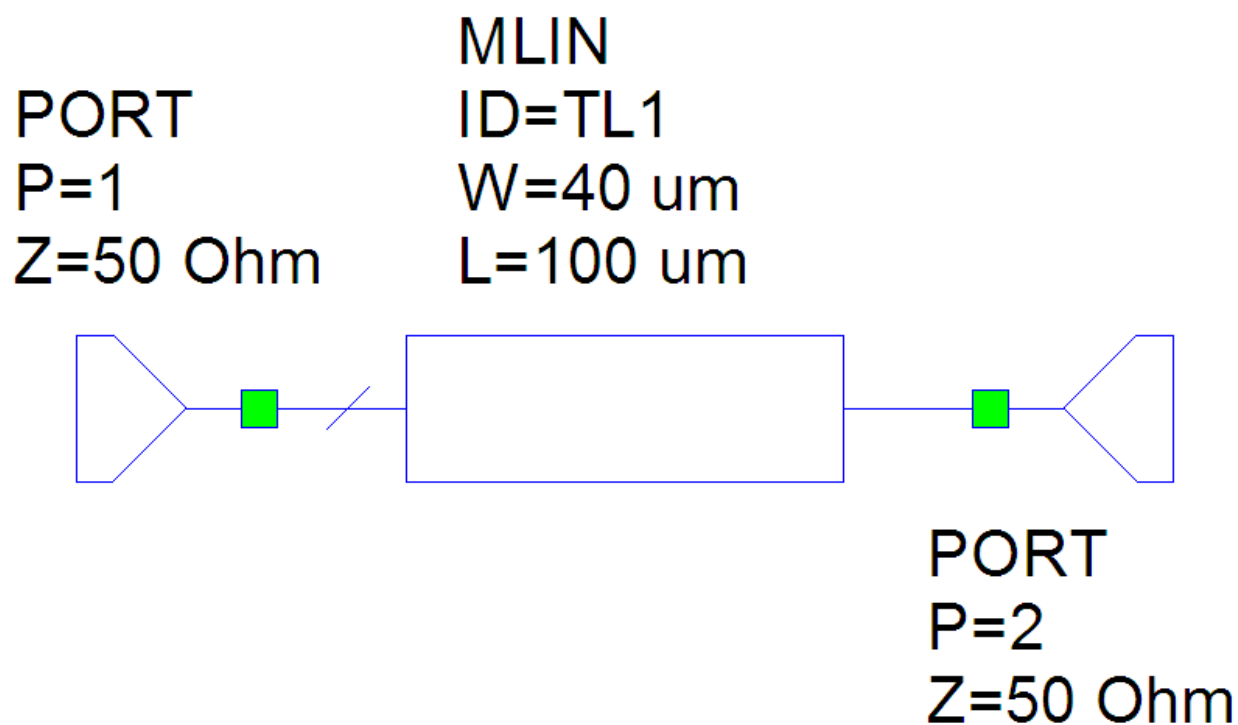

Below is the display after the script is run.

$Z=50 \text{ Ohm}$

$W=40 \text{ um}$
 $L=100 \text{ um}$



$Z=50 \text{ Ohm}$

Note: you will have to redraw the schematic (zoom in our out) to redraw to see the change.

There are two accompanying scripts, one will turn the display on and the other will toggle the display (turn on if they are off or turn off if they are on).

- [Turn On Element Display](#)
- [Toggle Element Display](#)